

THE TIN STAR[®]
ADDENDUM

This procedure may have to be done to the video PCB of SJ board sets.
The video board is the center board.

Boards affected: WW070002 and WW070002A

Problem: Sheriff lays down for no apparent reason.

Reason: Noise induced on "hit detect" signal.

Solution: Change C33, capacitor next to IC58, from 180pf to 330pf or
add a 330pf capacitor from IC58 pin 6 to ground.